



HOT GAS PATH INSPECTION ACCEPTANCE LETTER

Pilar #2 - Siemens V94.2 / Si3D (SGT5-2000E) Gas Turbine Generator

Customer / Plant	Electroingenieria S.A. / Central Termica Bicentenario
Plant Location	Pilar, Cordoba, Argentina
Unit	Pilar #2 / Pilar GT12
Gas Turbine Serial Number	800784
Gas Turbine Model	Siemens V94.2 / Si3D (SGT5-2000E)
Generator Serial Number	1007463
Inspection Type	33,000-Hour Hot Gas Path Inspection (HGPI)
HGPI Start Date	16 October 2022
HGPI Completion Date	14 November 2022
Acceptance Letter Date	24 November 2022
Report Prepared By	UNEW, Inc. - Field Service Team
Estimated Operating Record for HGPI Acceptance	
Estimated Starts Since Last C.I.	Approx. 34 starts
Estimated Trips Since Last C.I. (MOH)	Approx. 2 trips
Estimated Operating Hours Since Last C.I.	Approx. 16,400 operating hours
Estimated EOH Since Last C.I.	Approx. 16,000 EOH
Estimated Operating Hours Since Commissioning	Approx. 108,000 operating hours
Estimated EOH Since Commissioning	Approx. 110,000 EOH
Capital Parts Installation Period	2018 HGPI / November 2018 installation period
Estimated Service of Inspected Capital Parts	Approx. 32,000 operating hours / 33,000 EOH from 2018 installation to 14 November 2022

1. Acceptance Statement

This letter confirms that UNEW, Inc. completed the 33,000-hour Hot Gas Path Inspection (HGPI) work for Pilar #2 / Pilar GT12 on 14 November 2022. The HGPI work was inspected, reviewed, and found acceptable for close-out. UNEW issues this letter to Electroingenieria S.A. for plant review and approval of the completed HGPI work.

During the HGPI, the capital parts installed in the machine, including compressor blades, turbine vane segments, and turbine blades, were inspected. These parts were ordered from UNEW for the Pilar units. The compressor blades remained installed in the machine and were inspected in place. The turbine vane segments and turbine blades were removed and inspected as part of the HGPI scope.



Based on the inspection, UNEW certifies that the inspected capital parts are in good and acceptable condition. The compressor blade rows are suitable for continued operation. The removed turbine vane segments and turbine blades are good, serviceable, and refurbishable for the next service cycle, subject to normal shop refurbishment processes.

2. HGPI Work Completed and Accepted

No.	Task / Area	Work Completed	Status
1	Outage preparation and work control	Work permits, safety coordination, lifting/rigging preparation, tool control, and work area controls were completed before mechanical work.	Accepted / Approved
2	Machine shutdown, cooldown, and access	The unit was prepared for HGPI access. Covers, insulation, access panels, external hardware, and required inspection access points were opened in a controlled manner.	Accepted / Approved
3	FOD control and cleanliness	Foreign object control was maintained during casing opening, parts removal, inspection, and close-out.	Accepted / Approved
4	Inlet plenum and IGV inspection	Inlet plenum, bell mouth, inlet guide vanes, accessible fasteners, vane surfaces, and inlet flow path were inspected.	Accepted / Approved
5	Compressor blade rows 1-16 in-situ inspection	Accessible compressor blade rows 1 through 16 were inspected in place, including leading edges, trailing edges, airfoil surfaces, visible platforms, tips, and flow-path areas.	Accepted / Approved
6	Compressor flow-path condition review	Accessible compressor flow path was reviewed for deposits, corrosion marks, contact, abnormal rub, and loose material.	Accepted / Approved
7	Turbine casing opening and handling	Turbine casing and related access areas were opened and handled in accordance with normal outage practice.	Accepted / Approved
8	Hot gas path component identification	Removed hot gas path parts were identified by row, description, part number, quantity, and serial number where applicable.	Accepted / Approved
9	Removal and inspection of	Turbine vane rows 1 through 4 were removed and inspected as part of the HGPI scope.	Accepted / Approved



No.	Task / Area	Work Completed	Status
	turbine vane rows 1-4		
10	Removal and inspection of turbine blade rows 1-4	Turbine blade rows 1 through 4 were removed and inspected as part of the HGPI scope.	Accepted / Approved
11	Rotor wheel and blade slot review	Accessible rotor wheel areas, blade slots, locking areas, dovetail/fir-tree interfaces, and surrounding wheel surfaces were reviewed.	Accepted / Approved
12	Stator carrier and casing interface review	Vane carrier areas, casing grooves, seal locations, locating surfaces, joint areas, and support surfaces were checked before close-out.	Accepted / Approved
13	Cooling and sealing-air interfaces	Accessible cooling-air and sealing-air interfaces associated with hot gas path parts were checked.	Accepted / Approved
14	Visual and applicable field checks	Visual inspection and applicable field checks were completed for the HGPI scope.	Accepted / Approved
15	Dimensional and fit-up review	Accessible clearances, seating areas, seal lands, platforms, roots, and casing interfaces were reviewed.	Accepted / Approved
16	Hardware, locking, seals, and consumables	Associated locking hardware, seal interfaces, and consumable replacement requirements were reviewed.	Accepted / Approved
17	Reassembly readiness and preservation	Reassembly areas were checked for cleanliness and fit-up readiness. Removed components were accepted for packing and shop routing.	Accepted / Approved
18	Final walkdown and close-out	The inspection work, part disposition, and outage close-out were reviewed. No open item prevented acceptance of the HGPI work.	Accepted / Approved



3. Capital Parts Inspection Certification

Component / Area	Inspection Result	Certification
Compressor blade rows 1-16	Remained installed and inspected in place during the HGPI. The accessible blade rows were found in good and acceptable condition.	Certified good and suitable for continued operation
Turbine vane row 1	Removed and inspected during the HGPI. The vane segments were found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine vane row 2	Removed and inspected during the HGPI. The vane segments were found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine vane row 3	Removed and inspected during the HGPI. The vane segments were found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine vane row 4	Removed and inspected during the HGPI. The vane segments were found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine blade row 1	Removed and inspected during the HGPI. The blade set was found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine blade row 2	Removed and inspected during the HGPI. The blade set was found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine blade row 3	Removed and inspected during the HGPI. The blade set was found in good and acceptable condition.	Certified good, serviceable, and refurbishable
Turbine blade row 4	Removed and inspected during the HGPI. The blade set was found in good and acceptable condition.	Certified good, serviceable, and refurbishable

4. Final Close-Out Acceptance

Based on the completed HGPI work, the estimated operating record, and the inspection results, UNEW accepts the HGPI work for Pilar #2 / Pilar GT12 as complete. The unit work scope was completed, reviewed, and accepted for close-out.



UNEW, Inc.

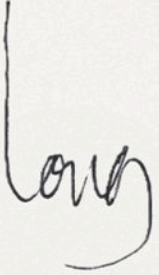
2570 N First Street, 2nd Floor

San Jose, CA 95131, USA

Tel: +1-408-892-2364 | Email: info@unew.us.com

UNEW further certifies that the installed compressor blade rows inspected in place are good and suitable for continued operation. The turbine vane segments and turbine blades removed and inspected during the HGPI are good, serviceable, and refurbishable. Serial numbers are listed by item in the appendices for plant traceability.

Acceptance Status: HGPI Work Completed and Accepted

For and on behalf of UNEW, Inc.	For and on behalf of Electroingeniería S.A.
Signature:  	Signature:  
Name / Title: Long Le, President	Name / Title: D. Gomez, VP Operations
Date: 24 November 2022	Date: 24 November 2022



APPENDIX A - CAPITAL PARTS SERIAL NUMBER TRACEABILITY AND INSPECTION CERTIFICATION

The following table identifies the capital parts inspected during the HGPI by item. The serial numbers are listed against each specific item for plant traceability. The inspection disposition is stated for each item.

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
1	Part No.: A2A50021940-G001 PB No.: PB0000251001 MBCSN: MBCSN10.0101	Standard Turbine Vane Segment, Row 1	each	42	AA18K3147, AA18K5691, AA18K6601, AA18K9052, AA18K5890 AA18K2136, AA18K2930, AA18K4372, AA18K8948, AA18K6004 AA18K3186, AA18K0707, AA18K5446, AA18K2156, AA18K9447 AA18K5287, AA18K4111, AA18K8556, AA18K9334, AA18K0928 AA18K4181, AA18K7418, AA18K0778, AA18K2580, AA18K7485 AA18K2284, AA18K1212, AA18K3643, AA18K8247, AA18K2157 AA18K7134, AA18K0478, AA18K2198, AA18K8242, AA18K6967 AA18K1483, AA18K1222, AA18K5178, AA18K3851, AA18K5384 AA18K1817, AA18K7893	Inspected during HGPI. Certified good, serviceable, and refurbishable.
2	Part No.: A2A50021941-G002 PB No.: PB0000251002 MBCSN: MBCSN90.0002	Joint/Lead Vane Segment, Row 1	each	2	AA18K1657, AA18K4783	Inspected during HGPI. Certified good, serviceable, and refurbishable.
3	Part No.: A2A50021942-G003 PB No.: PB0000251003 MBCSN: MBCSN90.0003	Instrumented/Transition Vane Segment, Row 1	each	2	AA18K4178, AA18K6451	Inspected during HGPI. Certified good, serviceable, and refurbishable.
4	Part No.: A2A50024312-G001 PB No.: PB0000251004 MBCSN:	Standard Turbine Vane Segment, Row 2	each	44	AA18K2988, AA18K3048, AA18K7367, AA18K7754, AA18K9294 AA18K0979, AA18K9210, AA18K6630, AA18K9320, AA18K6603 AA18K0775, AA18K8003, AA18K4430, AA18K7635, AA18K0731 AA18K3111, AA18K9893, AA18K8563, AA18K8653, AA18K3061	Inspected during HGPI. Certified good, serviceable, and refurbishable.



UNEW, Inc.
2570 N First Street, 2nd Floor
San Jose, CA 95131, USA
Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN10.0204				AA18K9016, AA18K3737, AA18K4107, AA18K4691, AA18K1765 AA18K3013, AA18K8146, AA18K4318, AA18K4230, AA18K7956 AA18K8264, AA18K7168, AA18K8860, AA18K2852, AA18K9499 AA18K4425, AA18K0949, AA18K3135, AA18K8938, AA18K1887 AA18K1810, AA18K9086, AA18K8617, AA18K4593	
5	Part No.: A2A50024312-G002 PB No.: PB0000251005 MBCSN: MBCSN90.0005	Joint Vane Segment, Row 2	each	2	AA18K3136, AA18K7686	Inspected during HGPI. Certified good, serviceable, and refurbishable.
6	Part No.: A2A50024312-G003 PB No.: PB0000251006 MBCSN: MBCSN10.0206	Instrumented Turbine Vane Segment, Row 2	each	2	AA18K6635, AA18K9709	Inspected during HGPI. Certified good, serviceable, and refurbishable.
7	Part No.: A2A5116244-G001 PB No.: PB0000251007 MBCSN: MBCSN10.0307	Standard Turbine Vane Segment, Row 3	each	45	AA18K6848, AA18K3410, AA18K9984, AA18K5809, AA18K8566 AA18K4251, AA18K7942, AA18K4014, AA18K6479, AA18K9533 AA18K0632, AA18K7879, AA18K7869, AA18K1083, AA18K2994 AA18K9278, AA18K1112, AA18K3529, AA18K3391, AA18K4149 AA18K9467, AA18K7968, AA18K5984, AA18K6672, AA18K1084 AA18K5822, AA18K6008, AA18K1105, AA18K8761, AA18K4088 AA18K4804, AA18K6149, AA18K3844, AA18K5263, AA18K3331 AA18K5647, AA18K5589, AA18K8852, AA18K1512, AA18K7492 AA18K0213, AA18K2419, AA18K9852, AA18K9986 AA18K6109	Inspected during HGPI. Certified good, serviceable, and refurbishable.
8	Part No.: A2A5116244-G002 PB No.:	Joint Vane Segment, Row 3	each	3	AA18K3778, AA18K8870, AA18K2624	Inspected during HGPI. Certified good,



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	PB0000251008 MBCSN: MBCSN90.0008					serviceable, and refurbishable.
9	Part No.: A2A5116244-G003 PB No.: PB0000251009 MBCSN: MBCSN10.0309	Instrumented Turbine Vane Segment, Row 3	each	3	AA18K9531, AA18K8731, AA18K3049	Inspected during HGPI. Certified good, serviceable, and refurbishable.
10	Part No.: A2A5118611-G001 PB No.: PB0000251010 MBCSN: MBCSN10.0410	Standard Turbine Vane Segment, Row 4	each	49	AA18K8641, AA18K3153, AA18K6379, AA18K8373, AA18K0732 AA18K8205, AA18K0163, AA18K3462, AA18K6288, AA18K7437 AA18K0686, AA18K3752, AA18K3387, AA18K1757, AA18K3034 AA18K5205, AA18K2725, AA18K5417, AA18K9785, AA18K6682 AA18K4024, AA18K7600, AA18K0839, AA18K1174, AA18K1295 AA18K4768, AA18K9882, AA18K4740, AA18K4100, AA18K0667 AA18K6456, AA18K9367, AA18K2019, AA18K5476, AA18K6447 AA18K5649, AA18K6157, AA18K6667, AA18K1705, AA18K4813 AA18K7322, AA18K8409, AA18K3782, AA18K0796 AA18K9472 AA18K2824, AA18K6482, AA18K9419, AA18K2527	Inspected during HGPI. Certified good, serviceable, and refurbishable.
11	Part No.: A2A5118611-G002 PB No.: PB0000251011 MBCSN: MBCSN90.0011	Joint Vane Segment, Row 4	each	3	AA18K4851, AA18K8355, AA18K0109	Inspected during HGPI. Certified good, serviceable, and refurbishable.
12	Part No.: A2A5118611-G003 PB No.: PB0000251012 MBCSN:	Instrumented Turbine Vane Segment, Row 4	each	3	AA18K4247, AA18K1319, AA18K5829	Inspected during HGPI. Certified good, serviceable, and refurbishable.



UNEW, Inc.
2570 N First Street, 2nd Floor
San Jose, CA 95131, USA
Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN10.0412					
13	Part No.: A2A50012458-G001 PB No.: PB0000252001 MBCSN: MBCSN11.0113	Standard Turbine Blade, Row 1	each	85	AA18K1865, AA18K5558, AA18K0050, AA18K8771, AA18K0605 AA18K4438, AA18K8002, AA18K2310, AA18K1097, AA18K2473 AA18K9436, AA18K9030, AA18K6269, AA18K7523, AA18K5859 AA18K3769, AA18K6165, AA18K1404, AA18K3086, AA18K1373 AA18K0614, AA18K6472, AA18K4266, AA18K1133, AA18K3821 AA18K3563, AA18K7567, AA18K5517, AA18K9176, AA18K7410 AA18K9851, AA18K9982, AA18K0616, AA18K1219, AA18K1629 AA18K3656, AA18K2117, AA18K0419, AA18K3719, AA18K6357 AA18K2368, AA18K1268, AA18K8244, AA18K3216 AA18K5126 AA18K5636, AA18K1717, AA18K9047, AA18K4786, AA18K2477 AA18K0412, AA18K6806 AA18K7952, AA18K1941, AA18K3228 AA18K8805, AA18K6366, AA18K5008, AA18K9942, AA18K8435 AA18K5722, AA18K8382, AA18K8951, AA18K1671, AA18K2551 AA18K2697, AA18K6139, AA18K0892, AA18K7954, AA18K3217 AA18K1115, AA18K5737, AA18K0950, AA18K2924, AA18K5462 AA18K5488, AA18K8935, AA18K5235, AA18K7472, AA18K3472 AA18K0252, AA18K3558, AA18K5935, AA18K2215, AA18K4726	Inspected during HGPI. Certified good, serviceable, and refurbishable.
14	Part No.: A2A50012458-G002 PB No.: PB0000252002 MBCSN: MBCSN11.0114	Locking Turbine Blade, Row 1	each	2	AA18K6089, AA18K1506	Inspected during HGPI. Certified good, serviceable, and refurbishable.
15	Part No.: A2A50012458-G003 PB No.: PB0000252003 MBCSN:	Weighted / Balanced Segment Blade, Row 1	each	2	AA18K2983, AA18K5936	Inspected during HGPI. Certified good, serviceable, and refurbishable.



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN90.0015					
16	Part No.: A2A50014822-G001 PB No.: PB0000252004 MBCSN: MBCSN11.0216	Standard Turbine Blade, Row 2	each	85	AA18K7162, AA18K1388, AA18K4479, AA18K4439, AA18K6740 AA18K8122, AA18K8702, AA18K5502, AA18K1957, AA18K5264 AA18K2119, AA18K0644, AA18K0504, AA18K9810, AA18K8248 AA18K9178, AA18K9377, AA18K3955, AA18K6605, AA18K9749 AA18K3842, AA18K5710 AA18K0922, AA18K2421, AA18K2582 AA18K8328, AA18K9006, AA18K9089, AA18K2549, AA18K2335 AA18K9653, AA18K9397, AA18K4927, AA18K5930, AA18K4130 AA18K3944, AA18K6325, AA18K4237, AA18K5552, AA18K0581 AA18K6167, AA18K7363, AA18K6563, AA18K0098, AA18K4325 AA18K2567, AA18K6129, AA18K3392, AA18K6556, AA18K9280 AA18K9570, AA18K1775, AA18K8056, AA18K3802, AA18K9552 AA18K4503, AA18K2692, AA18K6669, AA18K3431, AA18K6311 AA18K0364, AA18K8147, AA18K2180, AA18K0101, AA18K4841 AA18K1830, AA18K8480, AA18K1226, AA18K5124, AA18K6105 AA18K3951, AA18K0153, AA18K3478, AA18K8943 AA18K3709 AA18K4724, AA18K6681, AA18K9923, AA18K8757, AA18K1592 AA18K1720, AA18K0218 AA18K0536, AA18K2951, AA18K4796	Inspected during HGPI. Certified good, serviceable, and refurbishable.
17	Part No.: A2A50014822-G002 PB No.: PB0000252005 MBCSN: MBCSN11.0217	Locking Turbine Blade, Row 2	each	2	AA18K7234, AA18K8859	Inspected during HGPI. Certified good, serviceable, and refurbishable.
18	Part No.: A2A50014822-G003 PB No.: PB0000252006 MBCSN:	Weighted / Balanced Segment Blade, Row 2	each	2	AA18K2113, AA18K1545	Inspected during HGPI. Certified good, serviceable, and refurbishable.



UNEW, Inc.
2570 N First Street, 2nd Floor
San Jose, CA 95131, USA
Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN90.0018					
19	Part No.: A2A50113110-G001 PB No.: PB0000252007 MBCSN: MBCSN11.0319	Standard Turbine Blade, Row 3	each	59	AA18K5383, AA18K9190, AA18K6199, AA18K7843, AA18K4016, AA18K5864, AA18K4470, AA18K1960, AA18K0140, AA18K5166 AA18K8019, AA18K5053, AA18K1945, AA18K9960, AA18K3370 AA18K6219, AA18K7338, AA18K8406, AA18K2090, AA18K6505 AA18K9687, AA18K2298, AA18K2007, AA18K1291, AA18K5869 AA18K8968, AA18K2050, AA18K7823, AA18K8719, AA18K3892 AA18K2435, AA18K2467, AA18K3344, AA18K8170, AA18K5455 AA18K2693, AA18K4179, AA18K0594, AA18K5314, AA18K7038 AA18K3081, AA18K6696, AA18K1220, AA18K2187 AA18K2954 AA18K2777, AA18K7990, AA18K3734, AA18K5792, AA18K5921 AA18K6664, AA18K0023 AA18K3617, AA18K6273, AA18K5030 AA18K7095, AA18K2654, AA18K9463, AA18K3338	Inspected during HGPI. Certified good, serviceable, and refurbishable.
20	Part No.: A2A50113110-G002 PB No.: PB0000252008 MBCSN: MBCSN11.0320	Locking Turbine Blade, Row 3	each	2	AA18K3348, AA18K6644	Inspected during HGPI. Certified good, serviceable, and refurbishable.
21	Part No.: A2A50113110-G003 PB No.: PB0000252009 MBCSN: MBCSN90.0021	Weighted / Balanced Segment Blade, Row 3	each	2	AA18K9872, AA18K6322	Inspected during HGPI. Certified good, serviceable, and refurbishable.
22	Part No.: A2A50113110-G004 PB No.: PB0000252010 MBCSN:	Standard Turbine Blade, Row 4	each	42	AA18K1078, AA18K5947, AA18K0849, AA18K9585, AA18K5311 AA18K9920, AA18K2875, AA18K4289, AA18K7885, AA18K9440 AA18K6738, AA18K7371, AA18K9887, AA18K4168, AA18K3868 AA18K0881, AA18K8101, AA18K2585, AA18K6270, AA18K2222	Inspected during HGPI. Certified good, serviceable, and refurbishable.



UNEW, Inc.

2570 N First Street, 2nd Floor

San Jose, CA 95131, USA

Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN11.0422				AA18K2348, AA18K6359, AA18K1309, AA18K1369, AA18K4659 AA18K3898, AA18K2095, AA18K6047, AA18K3050, AA18K9707 AA18K3674, AA18K8471, AA18K3525, AA18K0575, AA18K0939 AA18K4714, AA18K2888, AA18K3496, AA18K0334, AA18K4695 AA18K1206, AA18K2731	
23	Part No.: A2A50113110-G005 PB No.: PB0000252011 MBCSN: MBCSN11.0423	Locking Blades (Master Blades / Closing Blades), Row 4	each	2	AA18K5402, AA18K8157	Inspected during HGPI. Certified good, serviceable, and refurbishable.
24	Part No.: A2A2001101-G001 PB No.: PB0000253001 MBCSN: MBCSN22.0123	Standard Compressor Blade, Row 1	set	1	AA18K3631	Inspected in place during HGPI. Certified good and suitable for continued operation.
25	Part No.: A2A2001101-G002 PB No.: PB0000253002 MBCSN: MBCSN22.0124	Locking Compressor Blade, Row 1	set	1	AA18K3179	Inspected in place during HGPI. Certified good and suitable for continued operation.
26	Part No.: A2A2001102-G001 PB No.: PB0000253003 MBCSN: MBCSN22.0225	Standard Compressor Blade, Row 2	set	1	AA18K7654	Inspected in place during HGPI. Certified good and suitable for continued operation.



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
27	Part No.: A2A2001102-G002 PB No.: PB0000253004 MBCSN: MBCSN22.0226	Locking Compressor Blade, Row 2	set	1	AA18K5206	Inspected in place during HGPI. Certified good and suitable for continued operation.
28	Part No.: A2A2001103-G001 PB No.: PB0000253005 MBCSN: MBCSN22.0327	Standard Compressor Blade, Row 3	set	1	AA18K7321	Inspected in place during HGPI. Certified good and suitable for continued operation.
29	Part No.: A2A2001103-G002 PB No.: PB0000253006 MBCSN: MBCSN22.0328	Locking Compressor Blade, Row 3	set	1	AA18K8394	Inspected in place during HGPI. Certified good and suitable for continued operation.
30	Part No.: A2A2001104-G001 PB No.: PB0000253007 MBCSN: MBCSN22.0429	Standard Compressor Blade, Row 4	set	1	AA18K3231	Inspected in place during HGPI. Certified good and suitable for continued operation.
31	Part No.: A2A2001104-G002 PB No.: PB0000253008 MBCSN:	Locking Compressor Blade, Row 4	set	1	AA18K9781	Inspected in place during HGPI. Certified good and suitable for



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN22.0430					continued operation.
32	Part No.: A2A2001105-G001 PB No.: PB0000253009 MBCSN: MBCSN22.0531	Standard Compressor Blade, Row 5	set	1	AA18K7689	Inspected in place during HGPI. Certified good and suitable for continued operation.
33	Part No.: A2A2001105-G002 PB No.: PB0000253010 MBCSN: MBCSN22.0532	Locking Compressor Blade, Row 5	set	1	AA18K3507	Inspected in place during HGPI. Certified good and suitable for continued operation.
34	Part No.: A2A2001106-G001 PB No.: PB0000253011 MBCSN: MBCSN22.0633	Standard Compressor Blade, Row 6	set	1	AA18K7209	Inspected in place during HGPI. Certified good and suitable for continued operation.
35	Part No.: A2A2001106-G002 PB No.: PB0000253012 MBCSN: MBCSN22.0634	Locking Compressor Blade, Row 6	set	1	AA18K2579	Inspected in place during HGPI. Certified good and suitable for continued operation.
36	Part No.: A2A2001107-G001 PB No.:	Standard Compressor Blade, Row 7	set	1	AA18K1867	Inspected in place during HGPI. Certified



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	PB0000253013 MBCSN: MBCSN22.0735					good and suitable for continued operation.
37	Part No.: A2A2001107-G002 PB No.: PB0000253014 MBCSN: MBCSN22.0736	Locking Compressor Blade, Row 7	set	1	AA18K7360	Inspected in place during HGPI. Certified good and suitable for continued operation.
38	Part No.: A2A2001108-G001 PB No.: PB0000253015 MBCSN: MBCSN22.0837	Standard Compressor Blade, Row 8	set	1	AA18K3772	Inspected in place during HGPI. Certified good and suitable for continued operation.
39	Part No.: A2A2001108-G002 PB No.: PB0000253016 MBCSN: MBCSN22.0838	Locking Compressor Blade, Row 8	set	1	AA18K3313	Inspected in place during HGPI. Certified good and suitable for continued operation.
40	Part No.: A2A2001109-G001 PB No.: PB0000253017 MBCSN: MBCSN22.0939	Standard Compressor Blade, Row 9	set	1	AA18K3308	Inspected in place during HGPI. Certified good and suitable for continued operation.



UNEW, Inc.
2570 N First Street, 2nd Floor
San Jose, CA 95131, USA
Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
41	Part No.: A2A2001109-G002 PB No.: PB0000253018 MBCSN: MBCSN22.0940	Locking Compressor Blade, Row 9	set	1	AA18K1107	Inspected in place during HGPI. Certified good and suitable for continued operation.
42	Part No.: A2A2001110-G001 PB No.: PB0000253019 MBCSN: MBCSN22.1041	Standard Compressor Blade, Row 10	set	1	AA18K8922	Inspected in place during HGPI. Certified good and suitable for continued operation.
43	Part No.: A2A2001110-G002 PB No.: PB0000253020 MBCSN: MBCSN22.1042	Locking Compressor Blade, Row 10	set	1	AA18K4245	Inspected in place during HGPI. Certified good and suitable for continued operation.
44	Part No.: A2A2001111-G001 PB No.: PB0000253021 MBCSN: MBCSN22.1143	Standard Compressor Blade, Row 11	set	1	AA18K6647	Inspected in place during HGPI. Certified good and suitable for continued operation.
45	Part No.: A2A2001111-G002 PB No.: PB0000253022 MBCSN:	Locking Compressor Blade, Row 11	set	1	AA18K7187	Inspected in place during HGPI. Certified good and suitable for



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	MBCSN22.1144					continued operation.
46	Part No.: A2A2001112-G001 PB No.: PB0000253023 MBCSN: MBCSN22.1245	Standard Compressor Blade, Row 12	set	1	AA18K7030	Inspected in place during HGPI. Certified good and suitable for continued operation.
47	Part No.: A2A2001112-G002 PB No.: PB0000253024 MBCSN: MBCSN22.1246	Locking Compressor Blade, Row 12	set	1	AA18K7429	Inspected in place during HGPI. Certified good and suitable for continued operation.
48	Part No.: A2A2001113-G001 PB No.: PB0000253025 MBCSN: MBCSN22.1347	Standard Compressor Blade, Row 13	set	1	AA18K5894	Inspected in place during HGPI. Certified good and suitable for continued operation.
49	Part No.: A2A2001113-G002 PB No.: PB0000253026 MBCSN: MBCSN22.1348	Locking Compressor Blade, Row 13	set	1	AA18K9897	Inspected in place during HGPI. Certified good and suitable for continued operation.
50	Part No.: A2A2001114-G001 PB No.:	Standard Compressor Blade, Row 14	set	1	AA18K5499	Inspected in place during HGPI. Certified



UNEW, Inc.
 2570 N First Street, 2nd Floor
 San Jose, CA 95131, USA
 Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
	PB0000253027 MBCSN: MBCSN22.1449					good and suitable for continued operation.
51	Part No.: A2A2001114-G002 PB No.: PB0000253028 MBCSN: MBCSN22.1450	Locking Compressor Blade, Row 14	set	1	AA18K2264	Inspected in place during HGPI. Certified good and suitable for continued operation.
52	Part No.: A2A2001115-G001 PB No.: PB0000253029 MBCSN: MBCSN22.1551	Standard Compressor Blade, Row 15	set	1	AA18K2942	Inspected in place during HGPI. Certified good and suitable for continued operation.
53	Part No.: A2A2001115-G002 PB No.: PB0000253030 MBCSN: MBCSN22.1552	Locking Compressor Blade, Row 15	set	1	AA18K9798	Inspected in place during HGPI. Certified good and suitable for continued operation.
54	Part No.: A2A2001116-G001 PB No.: PB0000253031 MBCSN: MBCSN22.1653	Standard Compressor Blade, Row 16	set	1	AA18K7194	Inspected in place during HGPI. Certified good and suitable for continued operation.



UNEW, Inc.
2570 N First Street, 2nd Floor
San Jose, CA 95131, USA
Tel: +1-408-892-2364 | Email: info@unew.us.com

No.	Part / PB / MBCSN	Description	Unit	Qty.	Serial Number(s)	Inspection Certification
55	Part No.: A2A2001116-G002 PB No.: PB0000253032 MBCSN: MBCSN22.1654	Locking Compressor Blade, Row 16	set	1	AA18K6876	Inspected in place during HGPI. Certified good and suitable for continued operation.

--- End of HGPI Inspection Acceptance Letter ---